


### III. Operation

- Connect Audio / Video cable into either AV1 Or AV2 properly
- Plug in DC 12V into DC jack.
- Turn Main Power "ON" & Press Power "ON"
- Select AV1 or AV2 by press ◀ (AV2) or ▶ (AV1).
- Press "Mode" to select Volume→Contrast→Brightness→Hue→Color→Sharpness  
Press ◀ (-) or ▶ (+) to adjust from 0 to 100.
- Press power on/off can control power of LCD monitor; no need to plug out DC +12V for turning off.

### IV. Drawing of Wring Application

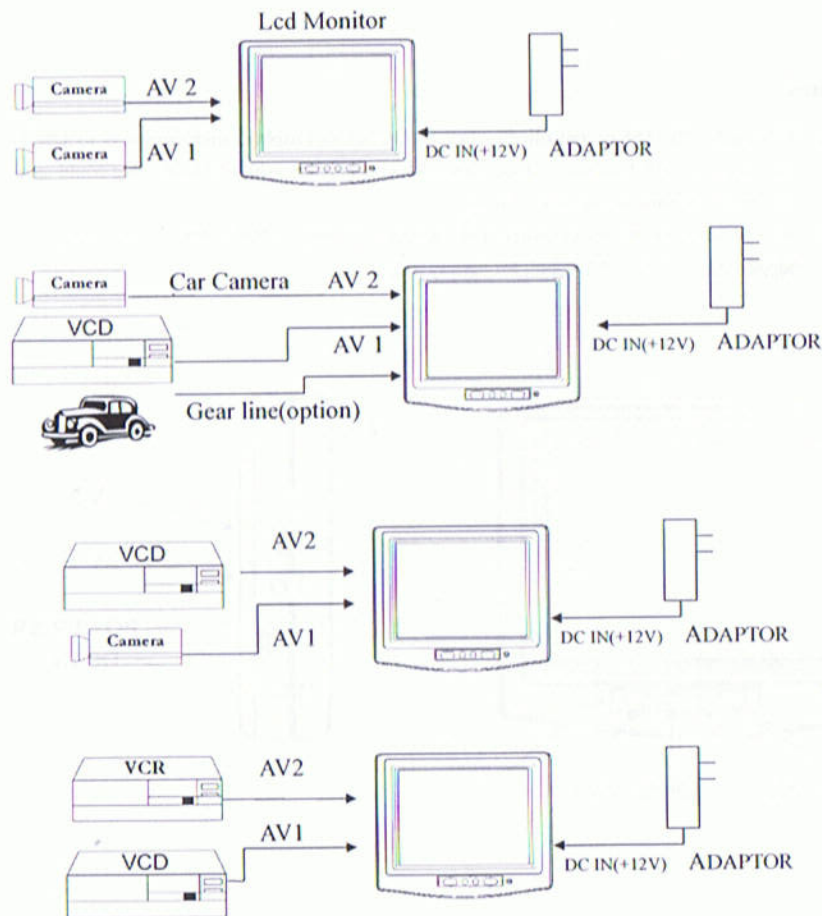

### V. Specification

MODEL	
Display	5.6" TFT Color LCD (LED B/L)
Pixels Number	640*3(RGB)*480
Action Area	112.896(W) x 84.672(H)
Dot Pitch	0.0588(W) x 0.1764(H)
System	NTSC/PAL(auto-switch)
Viewing angle	U/D/L/R: 50/70/70/70
Response Time	Tr=10ms max. Tf=15ms max
Brightness(nit)	200
Contrast Ratio	500:1
Video Input	2CH A/V Input 1.0Vp-p at 75Ω
Audio Input	2CH Input(MONO) 30mV~100mVp-p
Video/Audio Connector	Mini phone jack/Mini phone plug to RCA plug adapter
User Control	OSD Control: Mode, ◀, ▶, Power
Power Consumption	4.6 W
Dimensions (WxHxD)	160x 133x 37(mm)
Operation Temperature	0°C ~ 50°C
Storage Temperature	-20°C ~ 80°C
Weight (Monitor)	452 ± 10 g
Total Weight	2,095 ± 20 g